

**WIEGAND
FREEDOM OF SEAS
SHIP INSPECTION
(DECKS 11 & 12)
JANUARY 10, 2020**

WIEGAND FREEDOM OF SEAS SHIP INSPECTION (DECKS 11 & 12)

JANUARY 10, 2020

TABLE OF CONTENTS


OVERVIEW OF SUBJECT AREA DECK 11.....	3
REENACTMENT STILLs (AND CONTRAST OF ROYAL CARIBBEAN’S COURT FILED CCTV STILLs AND INTERPRETATION).....	9
CCTV CAMERAS IN AREA.....	34
WINDOW & FIXED GLASS MEASUREMENTS (FRONT).....	44
WINDOWS & FIXED GLASS MEASUREMENTS (PROFILE).....	65
H2O ZONE PROXIMITY TO SUBJECT WINDOW.....	72
FIXED TABLE, FIXED STOOL, AND MOVABLE CHAIR MEASUREMENTS.....	77
POUNDS OF FORCE TO OPEN SUBJECT WINDOW.....	85
FIXED GLASS DECK 12.....	87
ON DECK WARNINGS.....	98

OVERVIEW OF SUBJECT AREA DECK 11



PHOTO PREVIOUSLY PRODUCED BY ROYAL CARIBBEAN TO PUERTO RICO
AUTHORITIES DETAILING MOVEMENT BY CHLOE WIEGAND AND SAVATORE
(SAM) ANELLO:




DECK 11 - WALLS OF GLASS

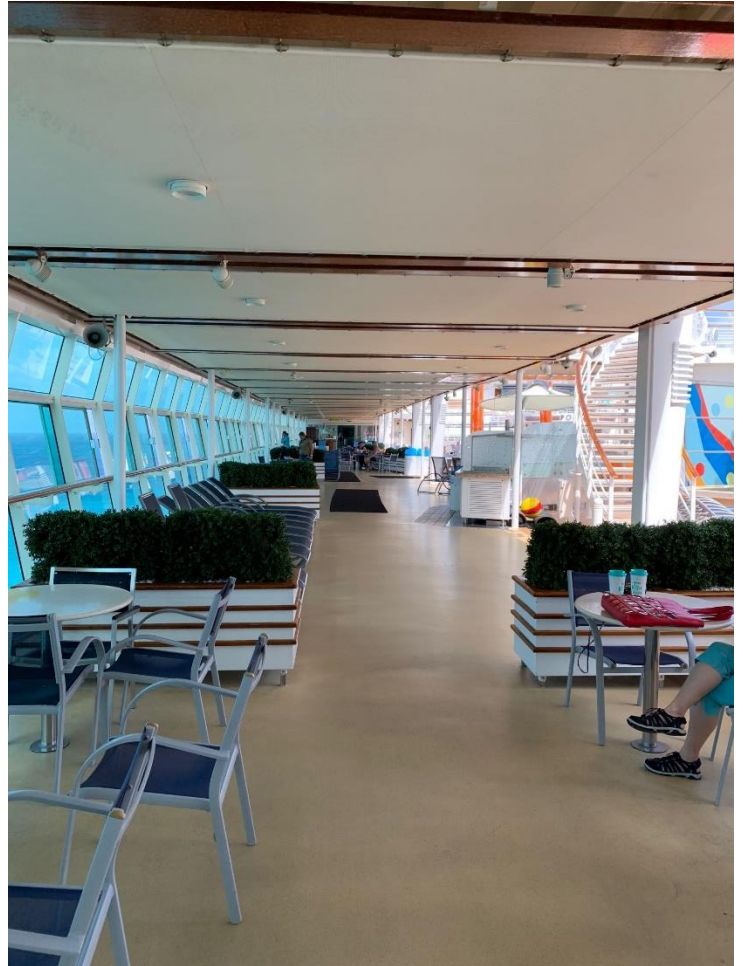


DECK 11 – WALLS OF GLASS

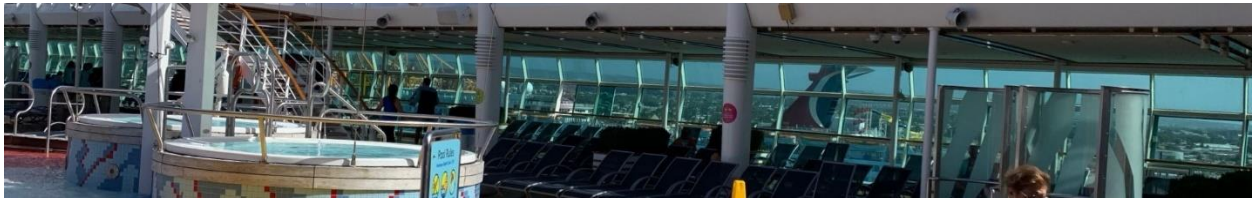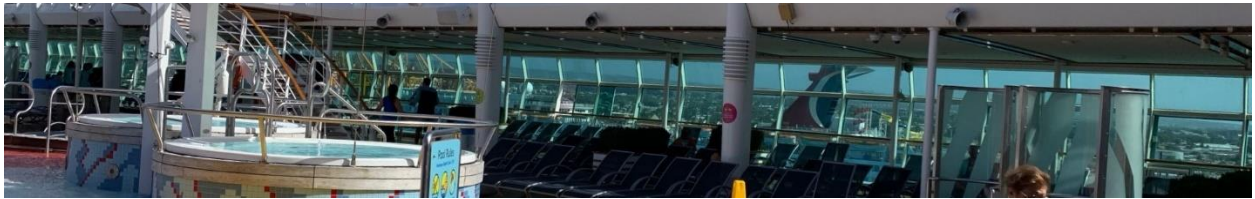

SUBJECT WINDOW AND FIXED GLASS AREA:

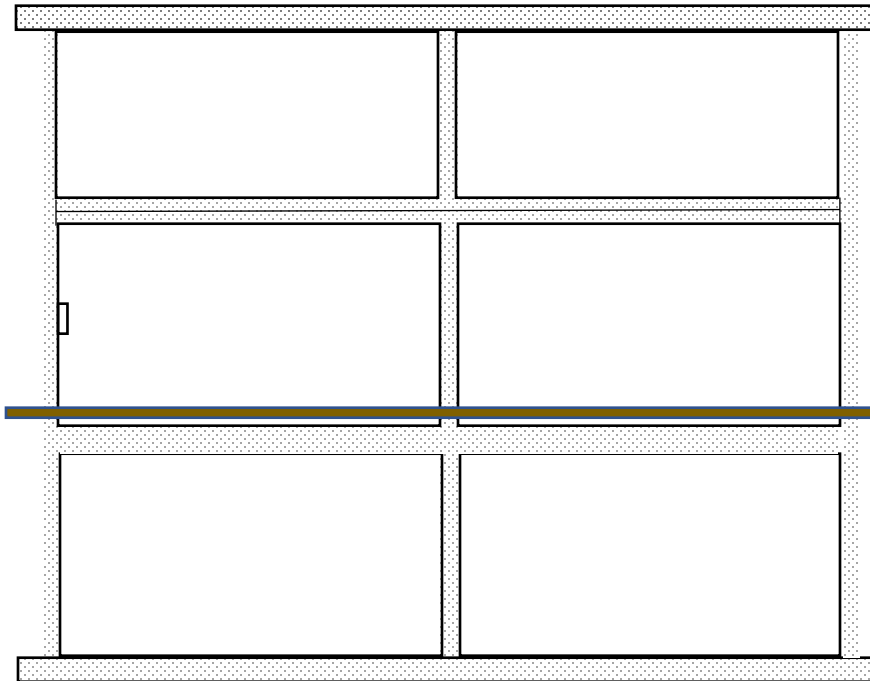

ADJACENT WINDOW AND FIXED GLASS AREA:

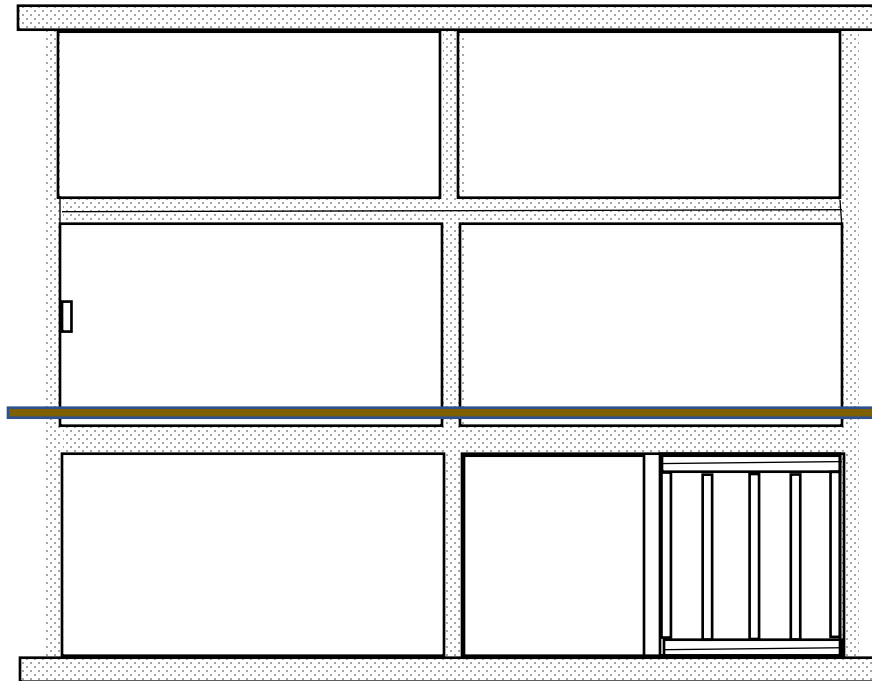

**REENACTMENT
STILLS
(AND CONTRAST OF
ROYAL CARIBBEAN'S
COURT FILED CCTV
STILLS AND
INTERPRETATION)**





FROM ROYAL CARIBBEAN'S MOTION TO DISMISS (FILED JANUARY 8, 2020):

There are two closed-circuit television cameras which captured the events leading to the fall.

The still shots taken from the videos show:

2. When he arrives at the open window, and while Chloe is on the floor, Mr. Anello leans his upper-torso over the wooden railing and out of the window frame for approximately eight seconds:



3. Because Mr. Anello had himself leaned out the window, he was well aware that the window was open. In addition, the windows in question consist of greenish-tinted glass making it open and obvious where a window is open versus closed.

The photo on the left was taken directly under the CCTV camera and shows the perspective of the CCTV video submitted by Royal Caribbean.


The photo on the right was taken in the same place, two steps to the right of the CCTV camera.



ROYAL CARIBBEAN'S
CCTV OF SAM ANELLO



REENACTMENT PHOTO
TAKEN UNDER CCTV
CAMERA

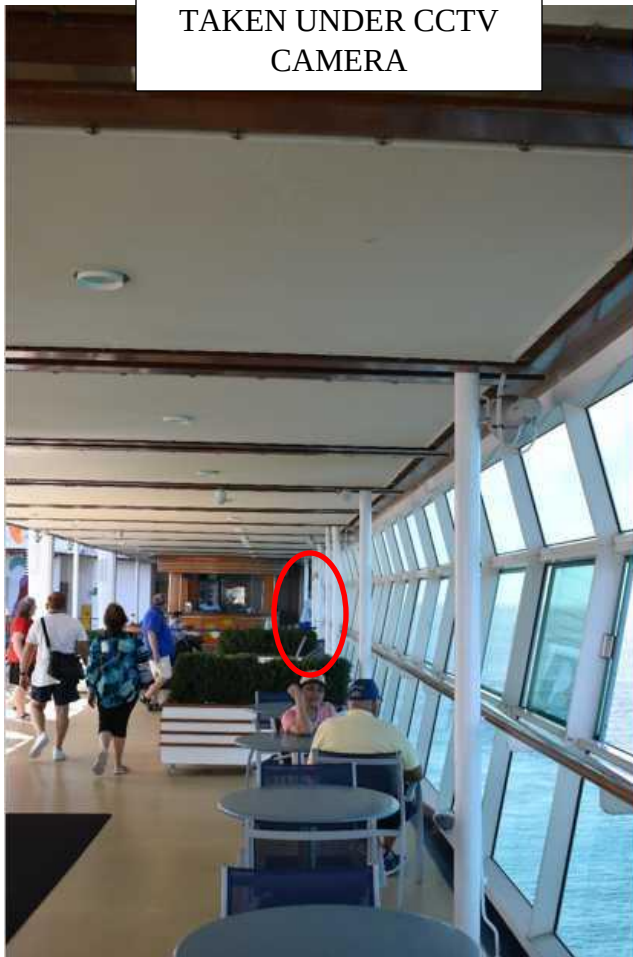

REENACTMENT PHOTO
TAKEN TWO STEPS TO
RIGHT OF CCTV
CAMERA



REENACTMENT PHOTO
TAKEN UNDER CCTV
CAMERA



REENACTMENT PHOTO
TAKEN TWO STEPS TO
RIGHT OF CCTV
CAMERA













Head just touching the window.

Feet 7" off the deck.





FROM ROYAL CARIBBEAN'S MOTION TO DISMISS (FILED JANUARY 8, 2020):

6. Mr. Anello stays in front of the open window and exposes Chloe to the open window, which was 11 decks high off the ground, with nothing but a concrete pier below, for approximately 34 seconds at which time she unfortunately fell.



7. The only reasonable conclusion from the video is that Mr. Anello knew the window was open before picking up Chloe. He nonetheless lifted the child over the wooden rail and the open window for a considerable period, recklessly endangering her life. There was no “hidden danger” — Mr. Anello knew the window was open.

ROYAL CARIBBEAN'S
CCTV OF SAM ANELLO



ROYAL CARIBBEAN'S
CCTV OF SAM ANELLO
(CROPPED
AND
ENLARGED)



REENACTMENT PHOTO
TAKEN UNDER CCTV
CAMERA
(MATCHED
PERSPECTIVE)



ROYAL CARIBBEAN'S
CCTV OF SAM ANELLO
(CROPPED
AND
ENLARGED)



REENACTMENT PHOTO
TAKEN UNDER CCTV
CAMERA
(MATCHED
PERSPECTIVE)



REENACTMENT PHOTO
TAKEN UNDER CCTV
CAMERA



REENACTMENT PHOTO
TAKEN TWO STEPS TO
THE RIGHT OF CCTV
CAMERA



REENACTMENT PHOTOS
TAKEN TWO STEPS TO
THE RIGHT OF CCTV
CAMERA



ROYAL CARIBBEAN'S
CCTV OF SAM ANELLO
AND CHLOE WEIGAND
(CROPPED AND
ENLARGED)



REENACTMENT PHOTO
TAKEN TWO STEPS TO
THE RIGHT OF CCTV
CAMERA



REENACTMENT PHOTO



REENACTMENT PHOTO
TAKEN TWO STEPS TO
THE RIGHT OF CCTV
CAMERA



VIEW STANDING AT HANDRAIL LOOKING OUT THE WINDOW:

1. APPROACHING HANDRAIL



2. STANDING AT HANDRAIL, LOOKING FORWARD:



3. STANDING AT HANDRAIL, LOOKING DOWN (1 OF 2):




4. STANDING AT HANDRAIL, LOOKING DOWN (2 OF 2):



5. STANDING AT HANDRAIL, LOOKING UP:



6. STANDING AT HANDRAIL, LOOKING LEFT:

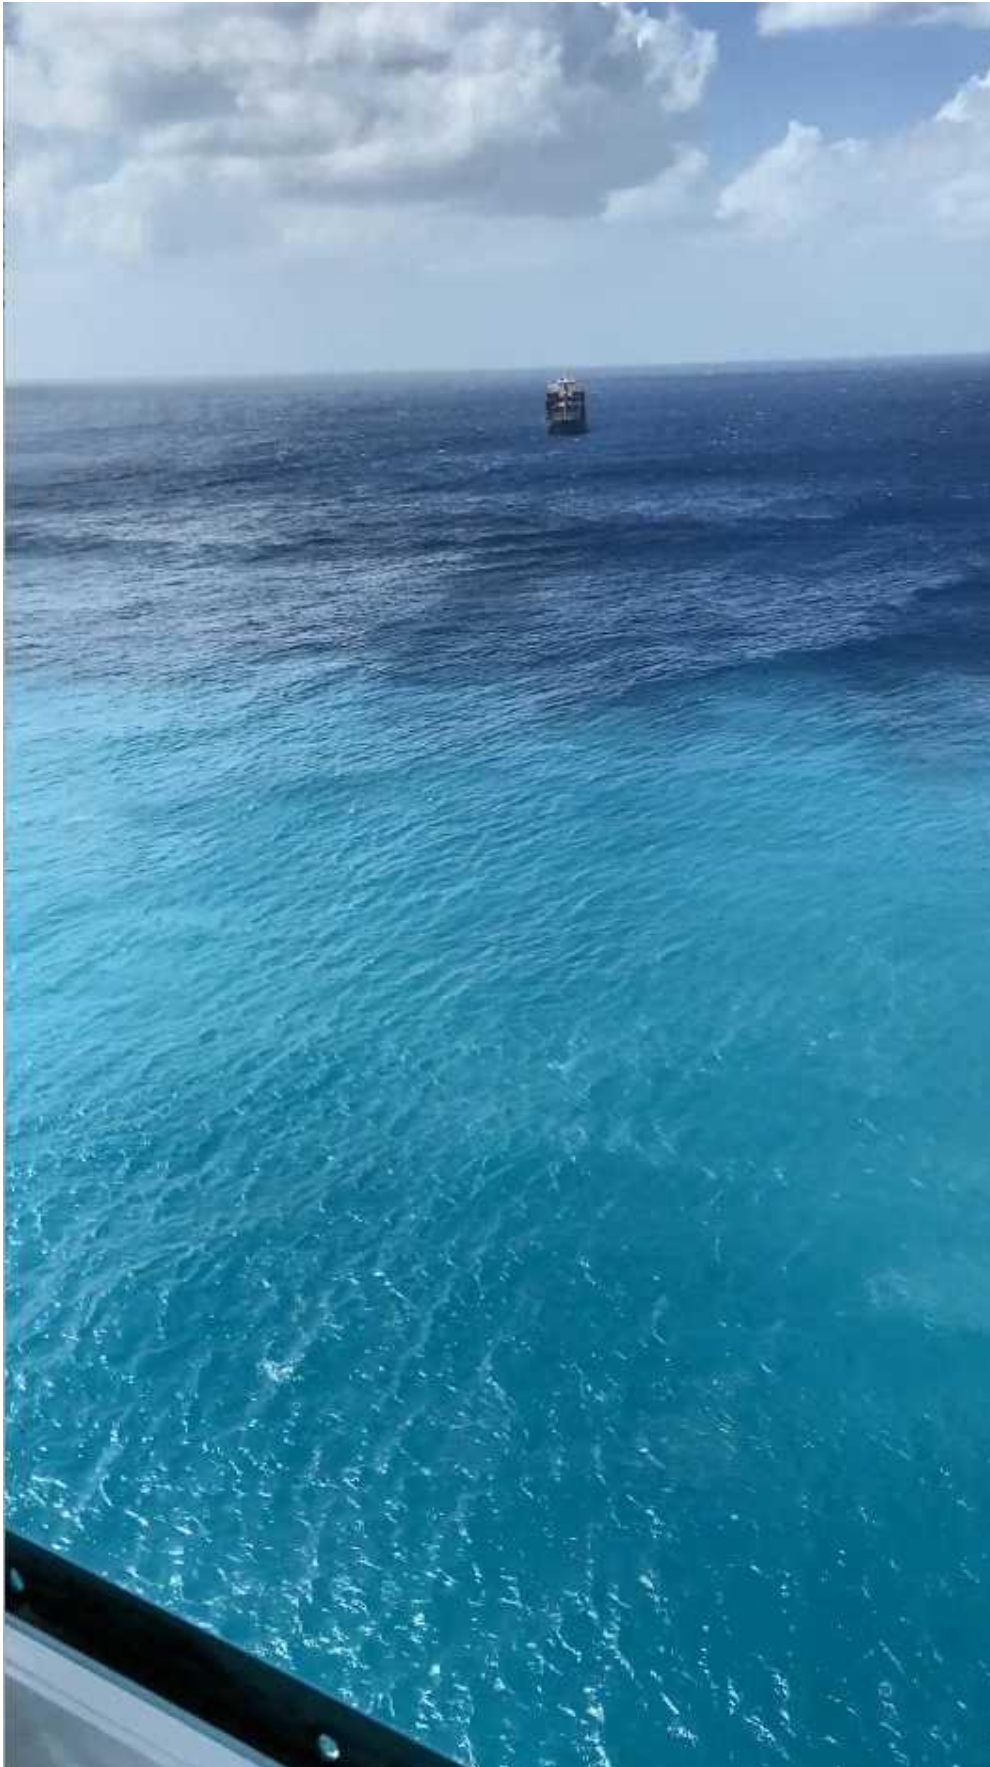

7. STANDING AT HANDRAIL, LOOKING RIGHT:



CCTV CAMERAS IN AREA





353



BRIDGE
WING
CAMERA



346



NO
NUMBER



???



004

353



339

NO
NUMBER












WINDOWS & FIXED GLASS MEASUREMENTS (FRONT)

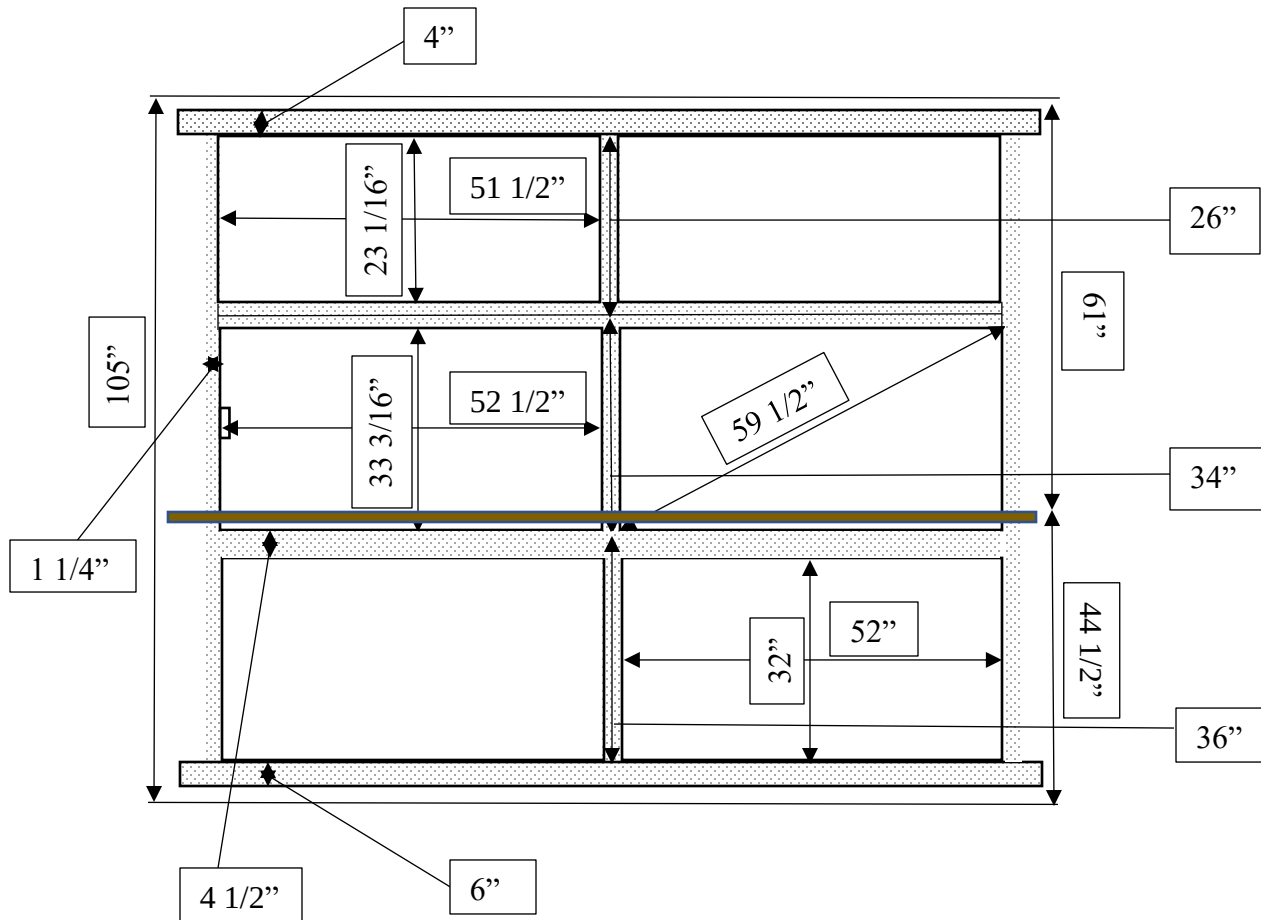


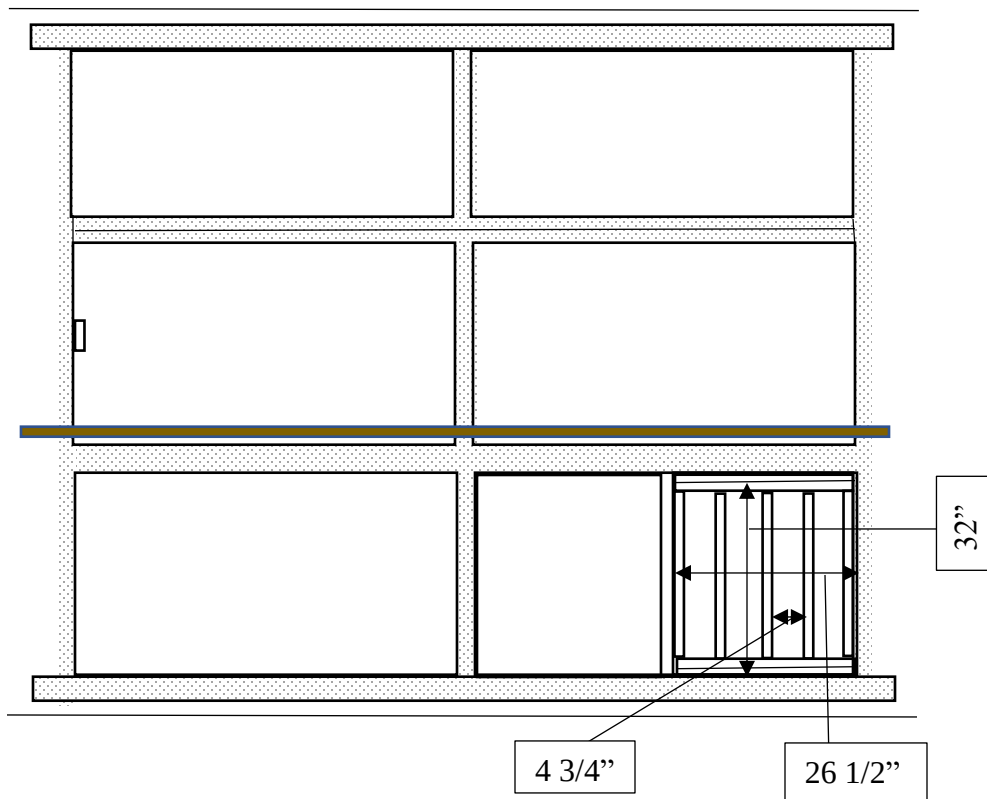

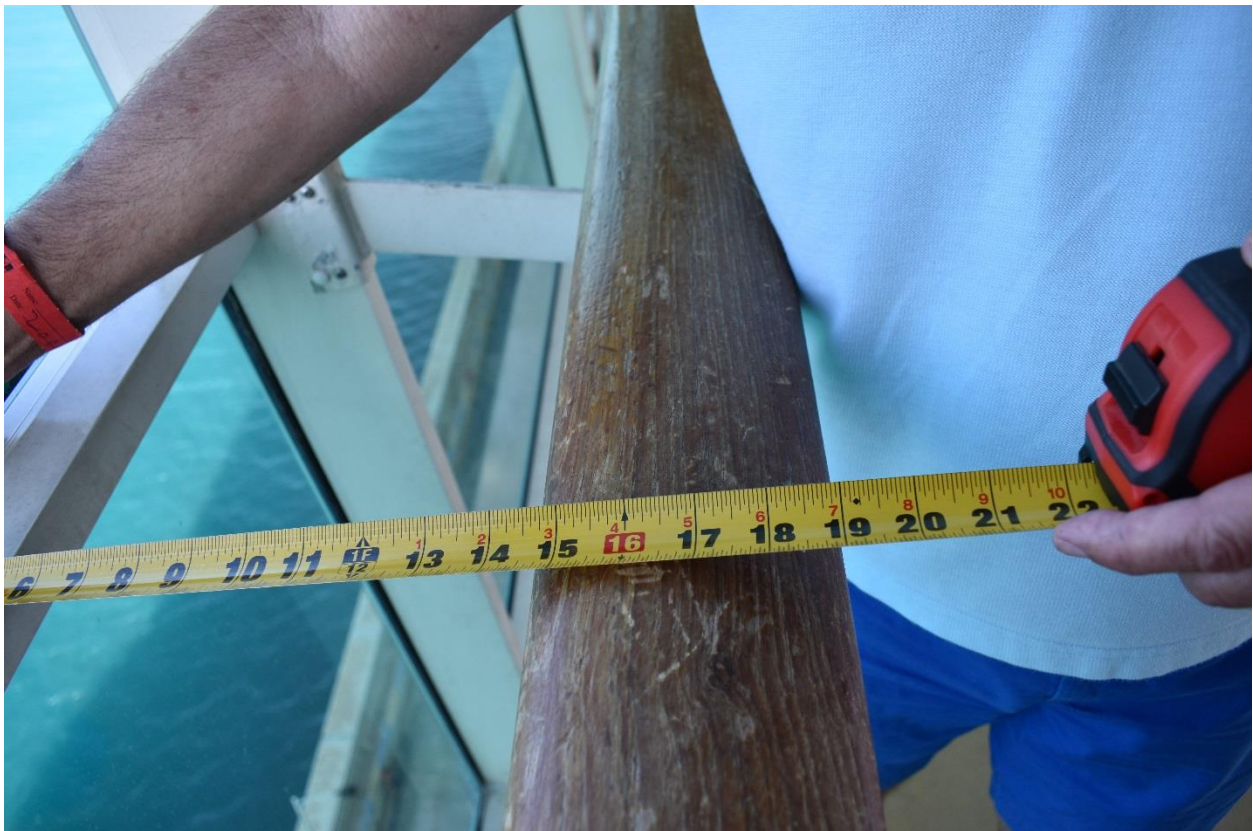





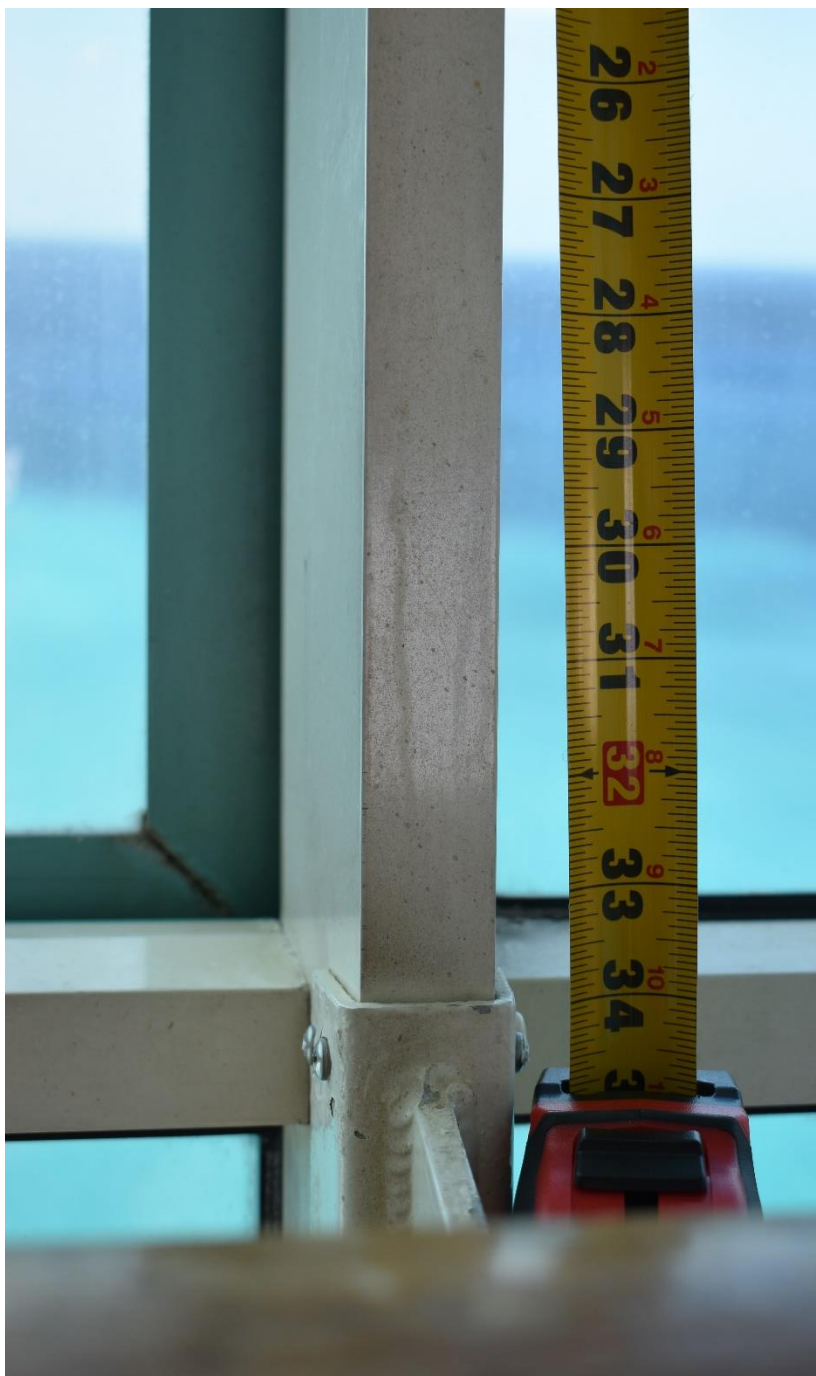































WINDOWS & FIXED GLASS MEASUREMENTS (PROFILE)

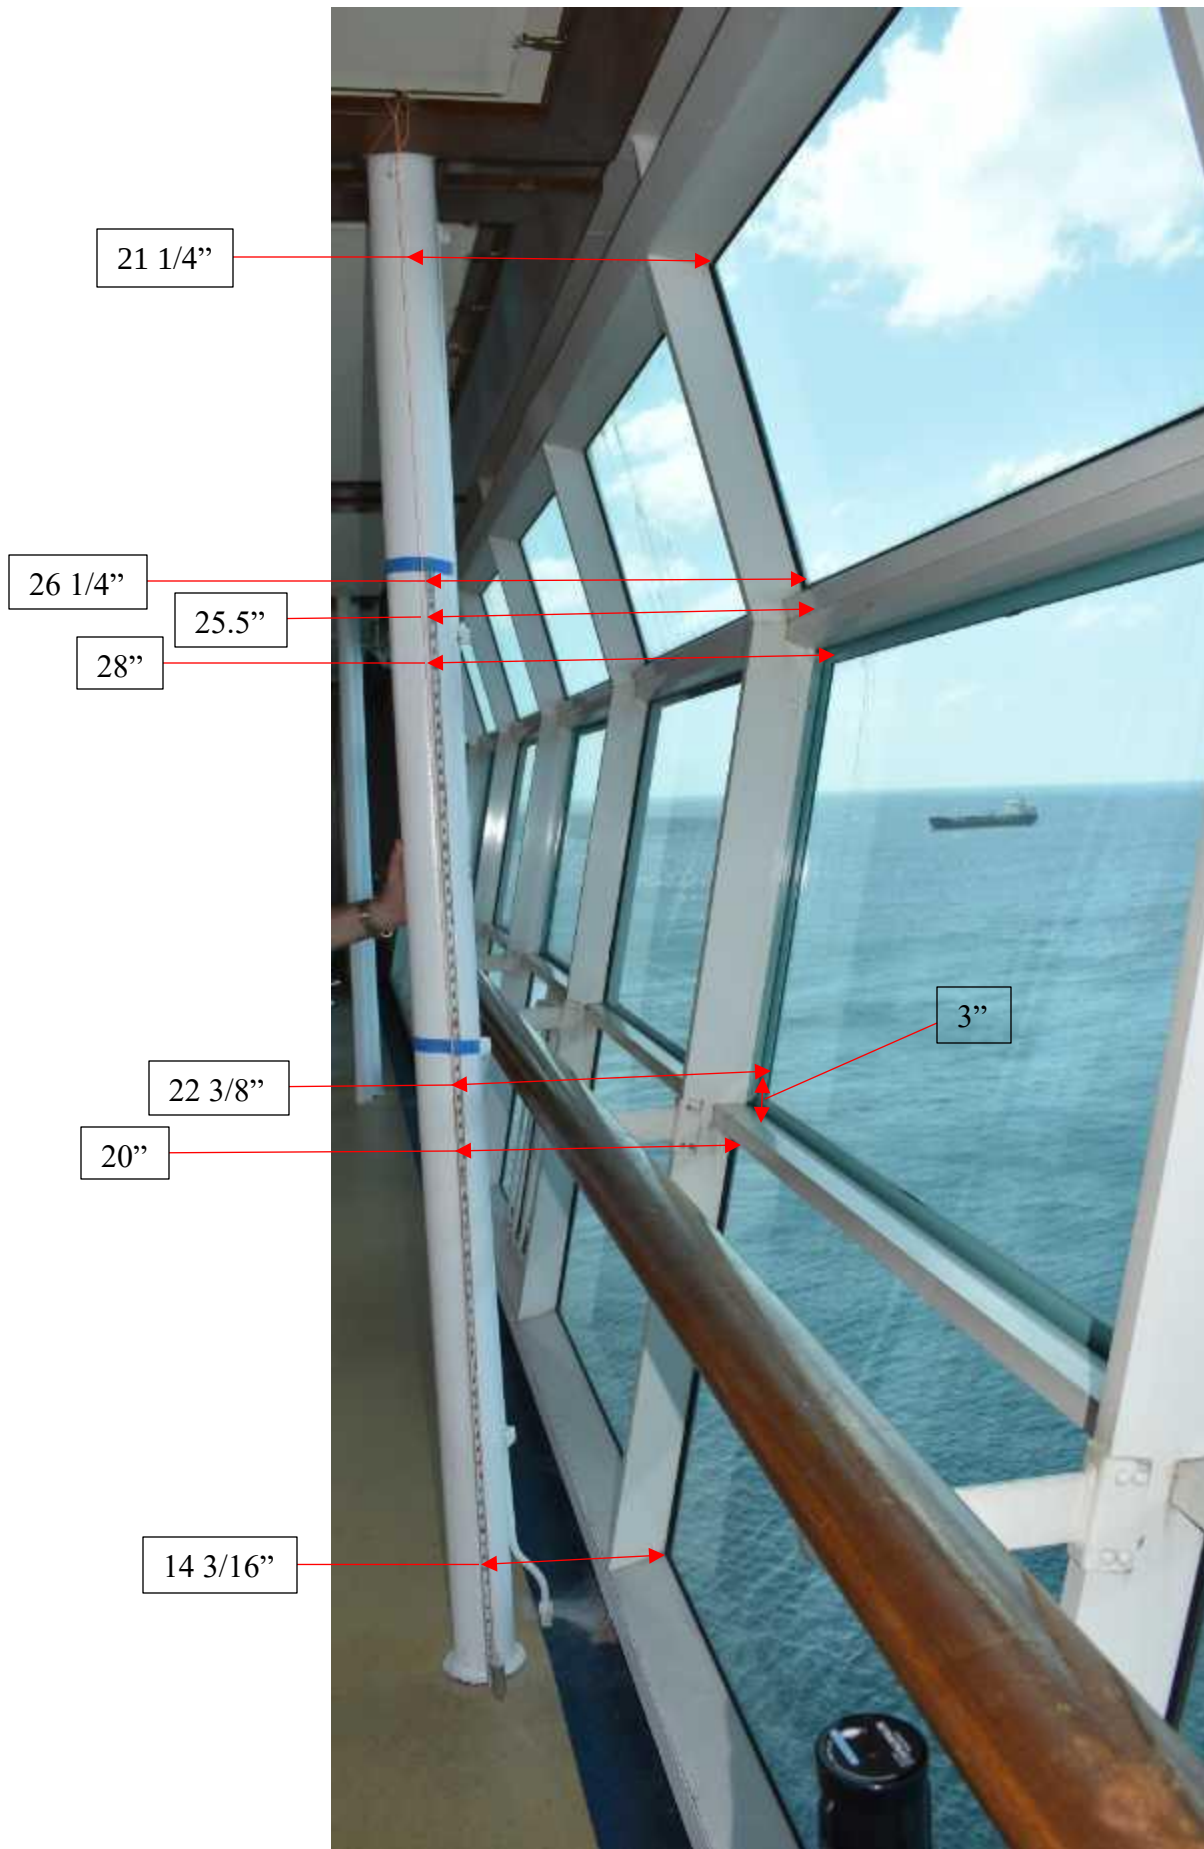

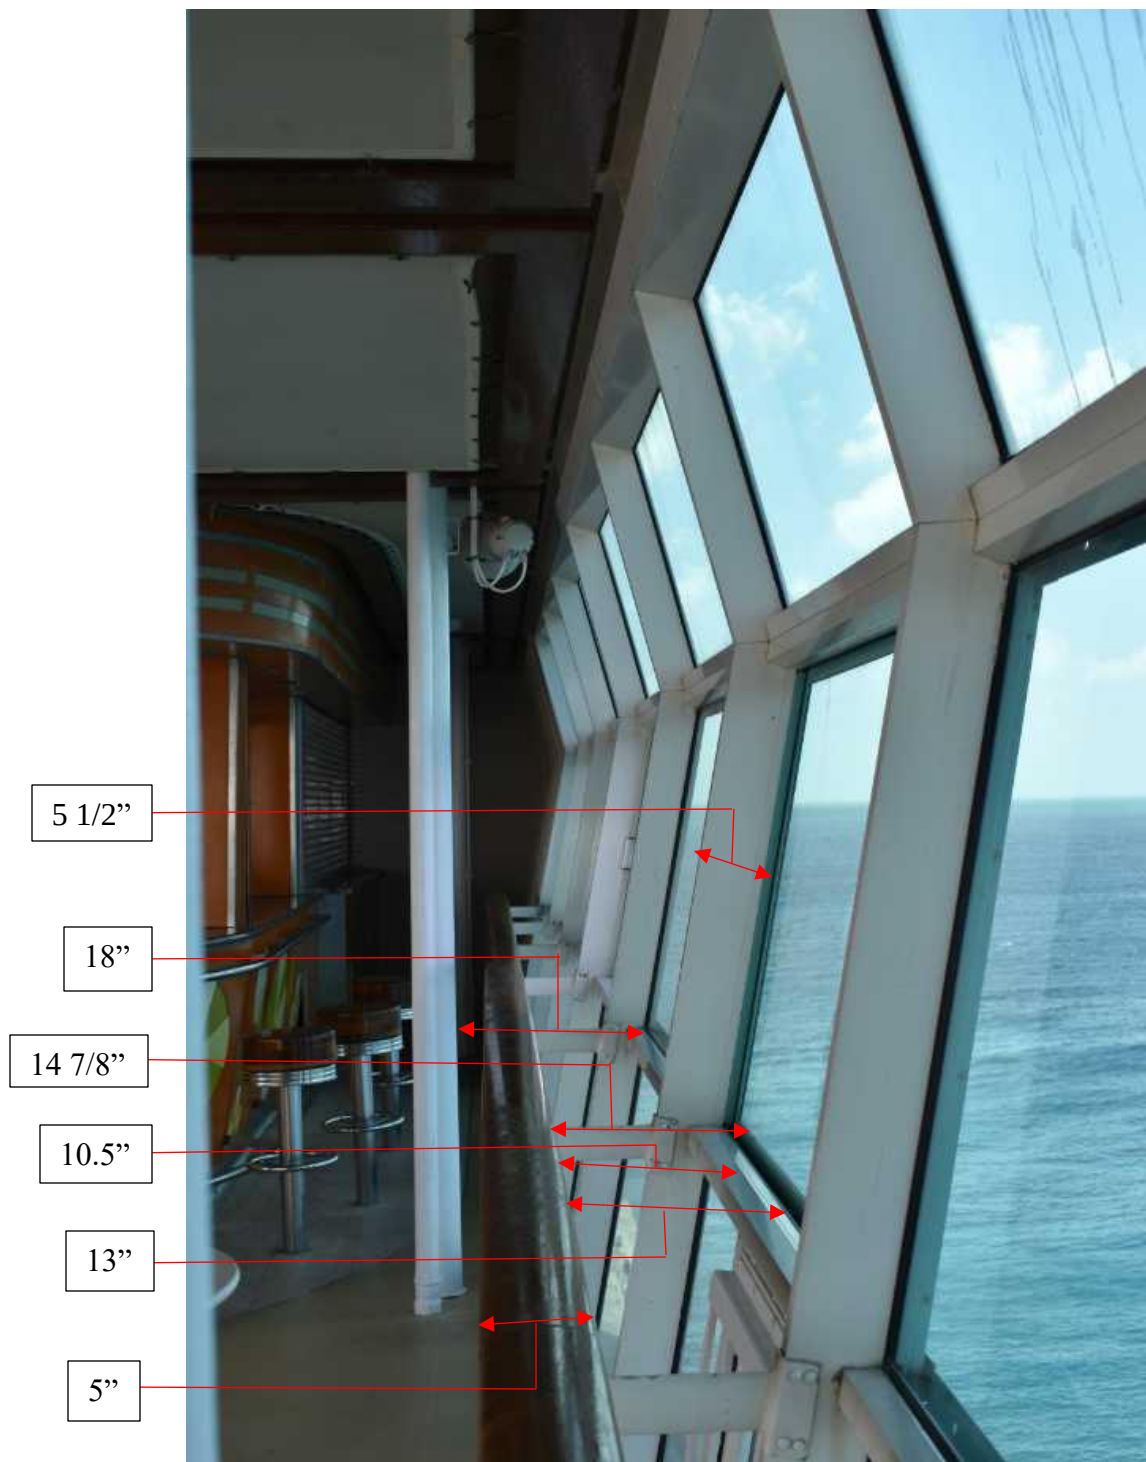










H2O ZONE PROXIMITY TO SUBJECT WINDOW






H2O ZONE IS 43.33 FEET FROM SUBJECT WINDOW:




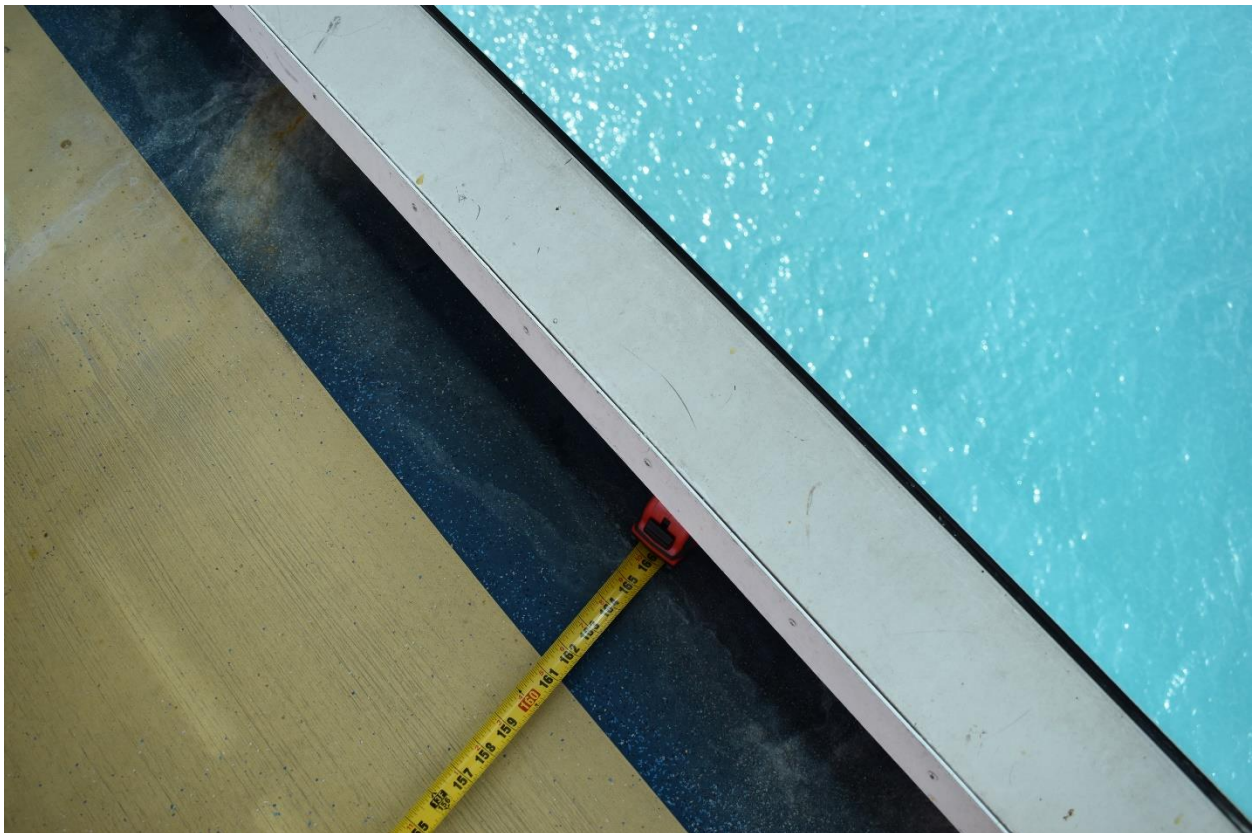


FIXED TABLE, FIXED STOOL, AND MOVABLE CHAIR MEASUREMENTS

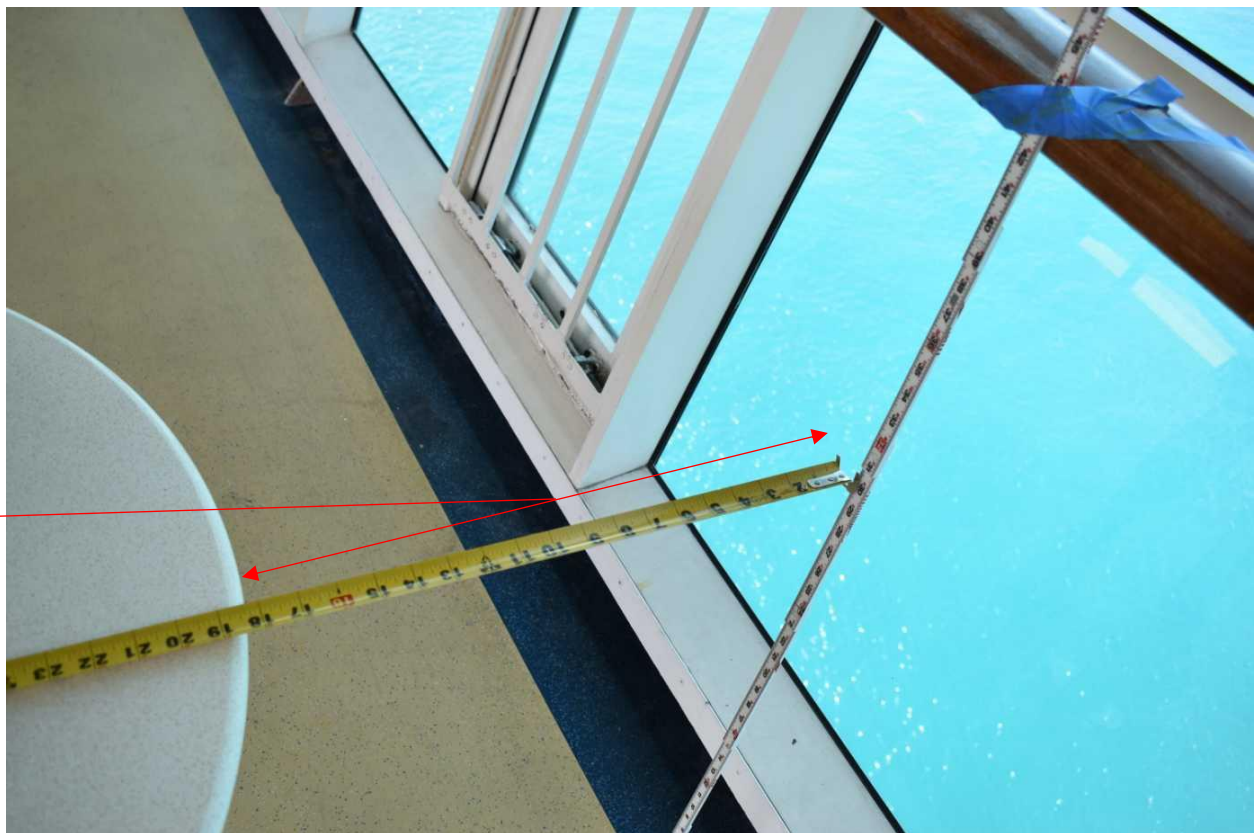


22 1/2"

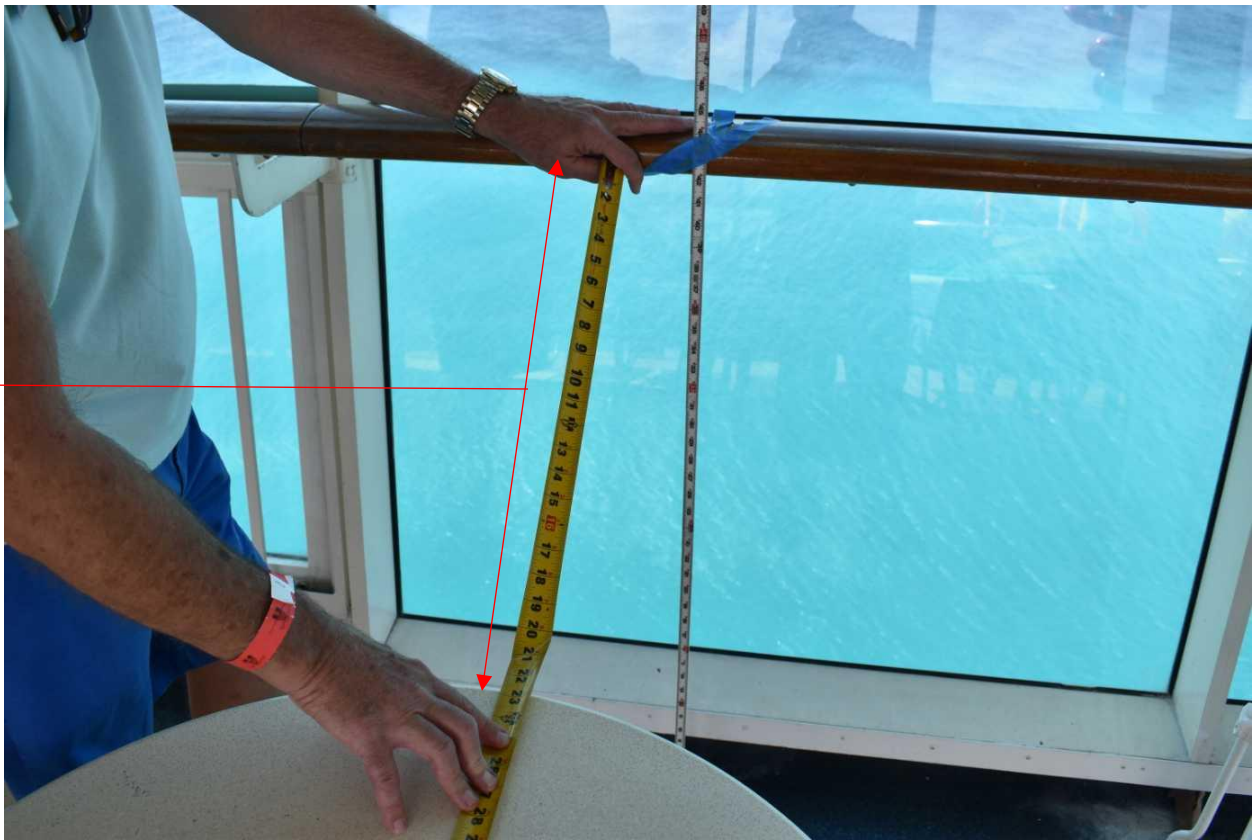


31"

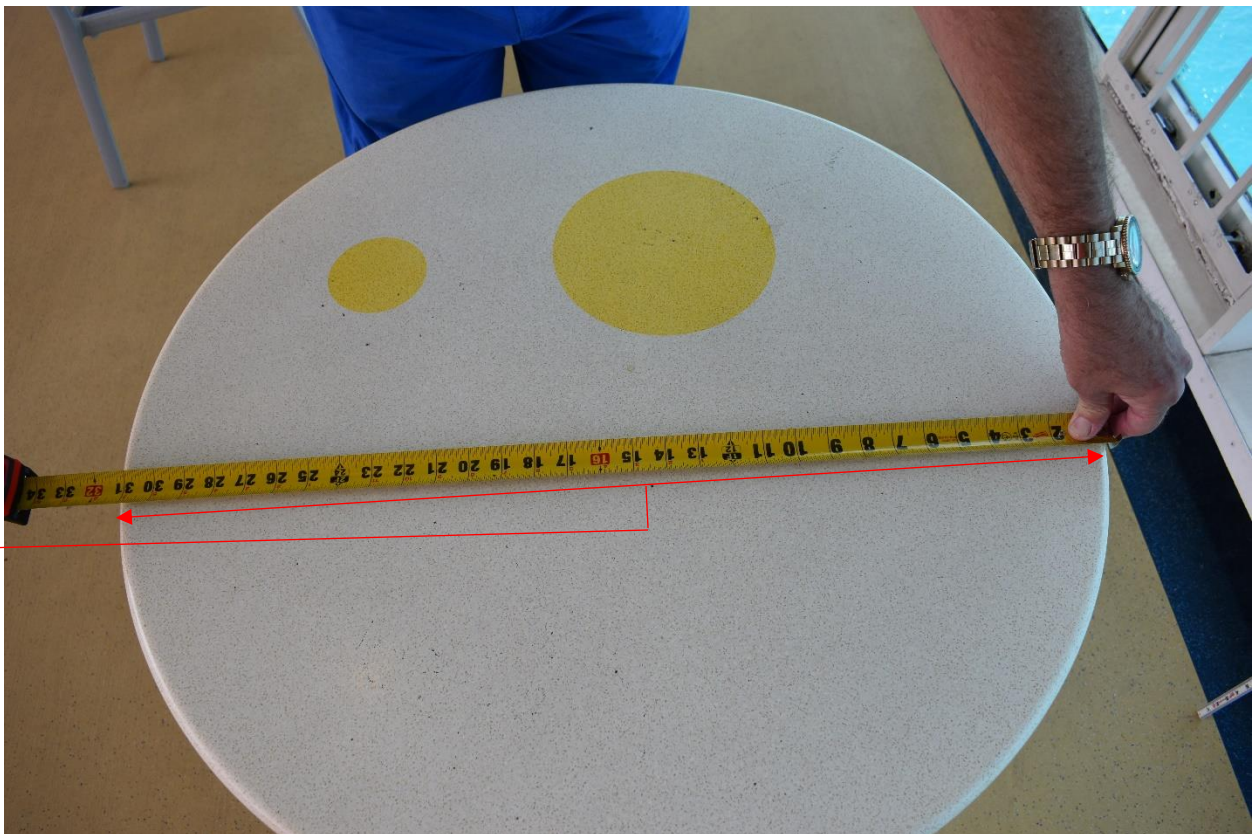


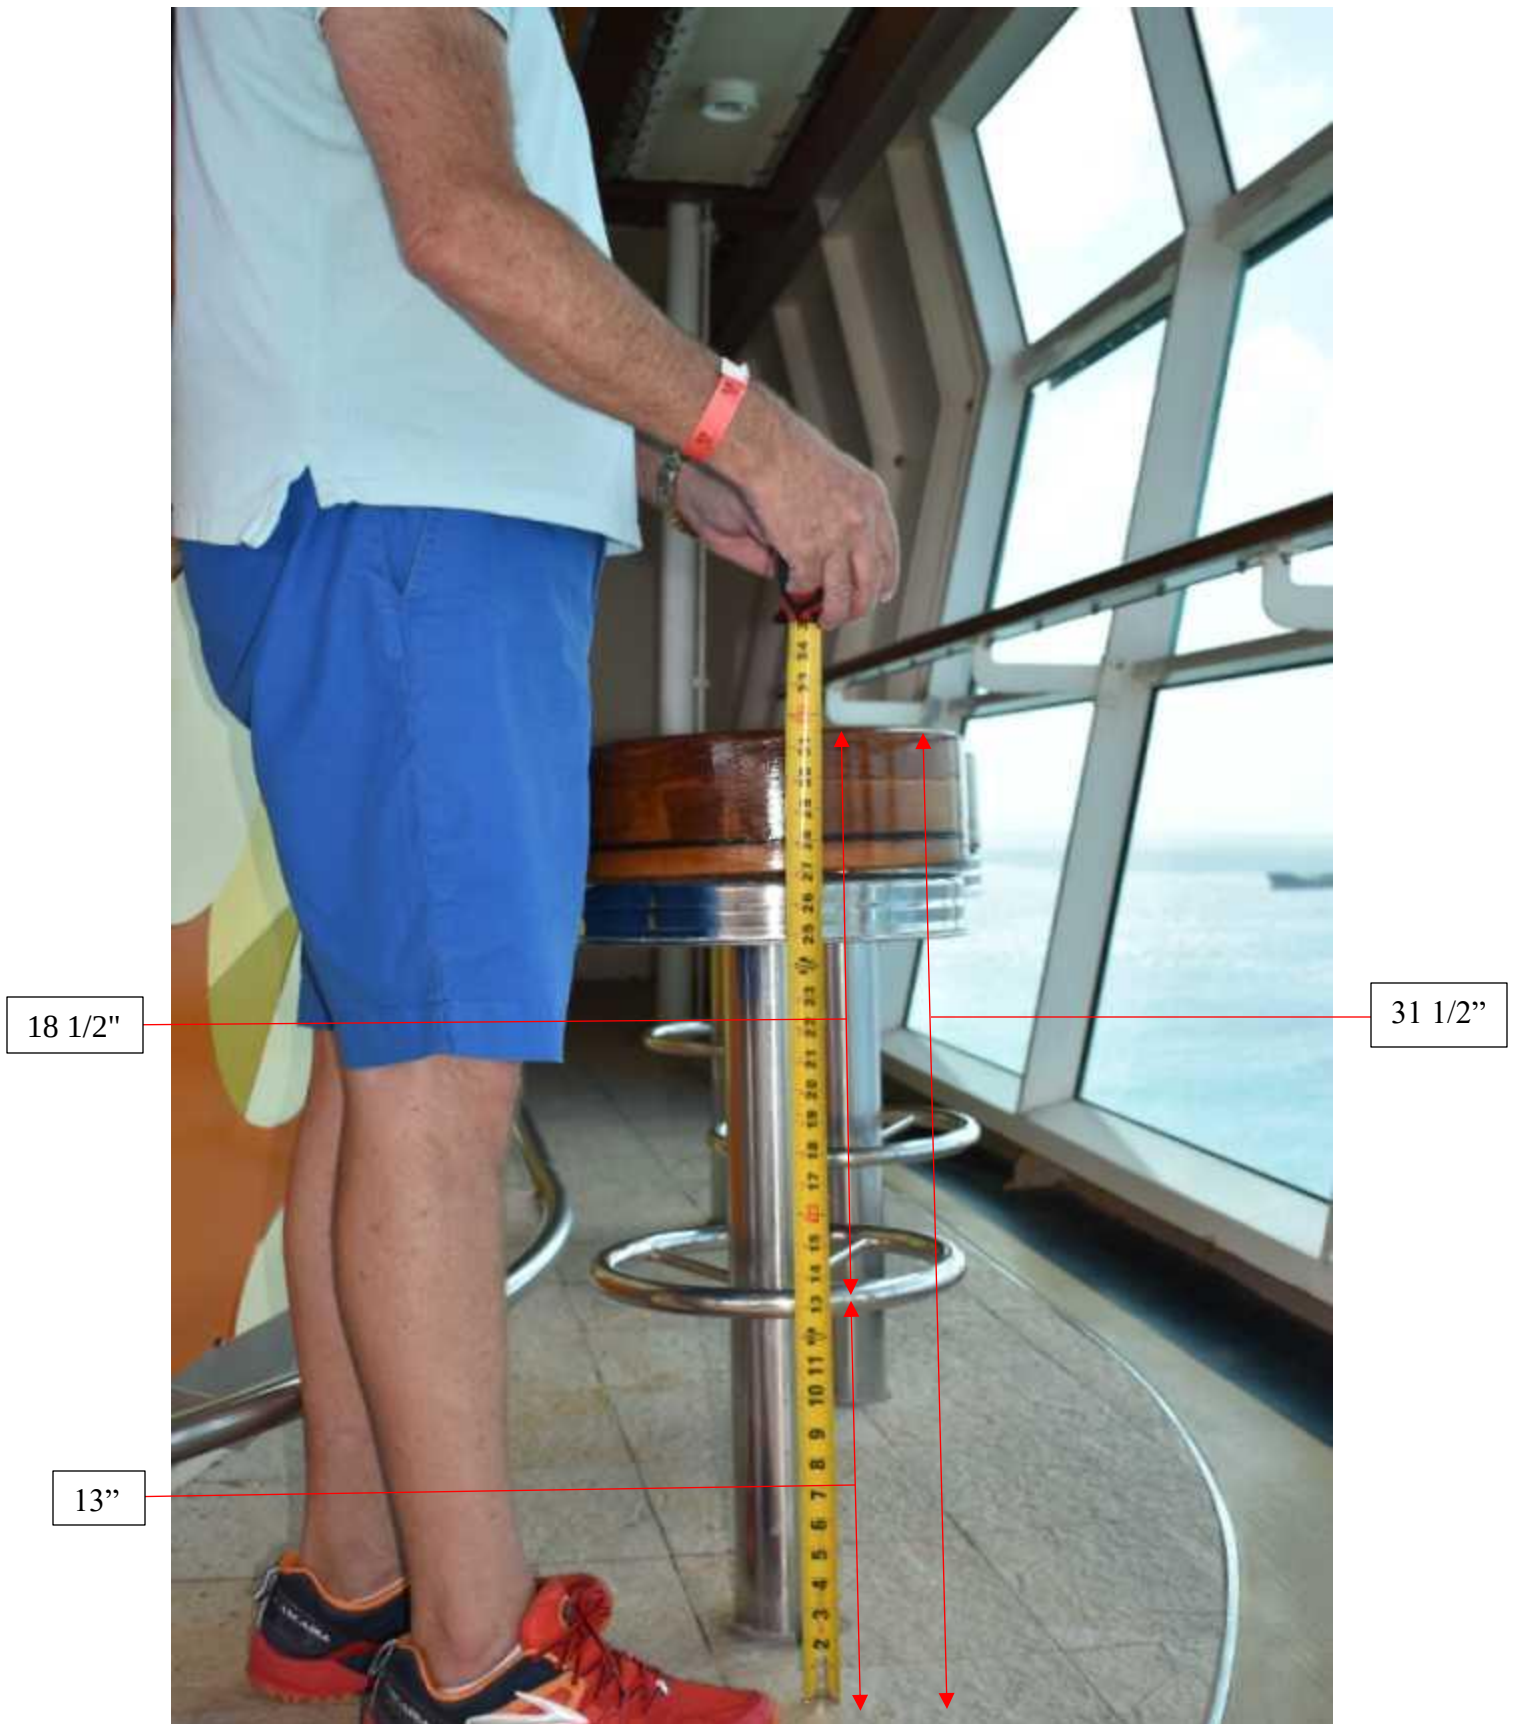


13 3/4"

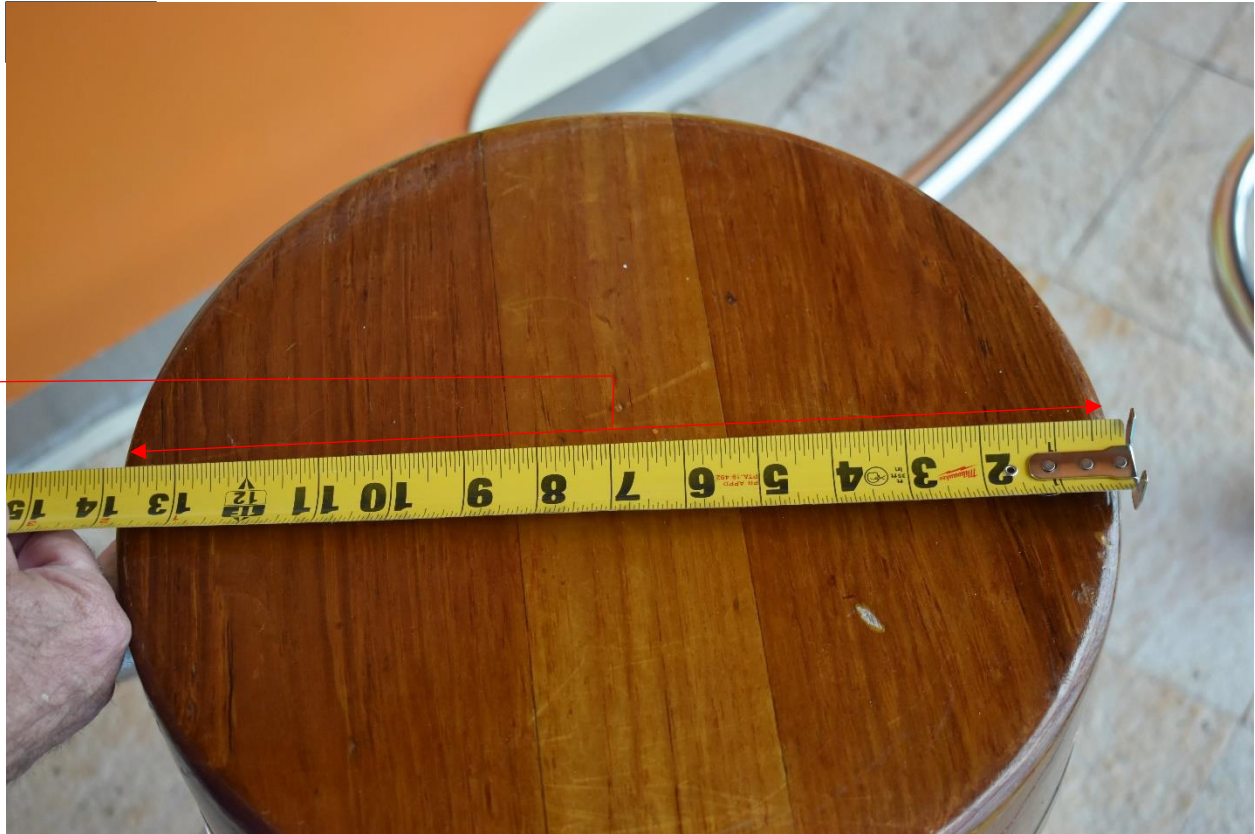

22"

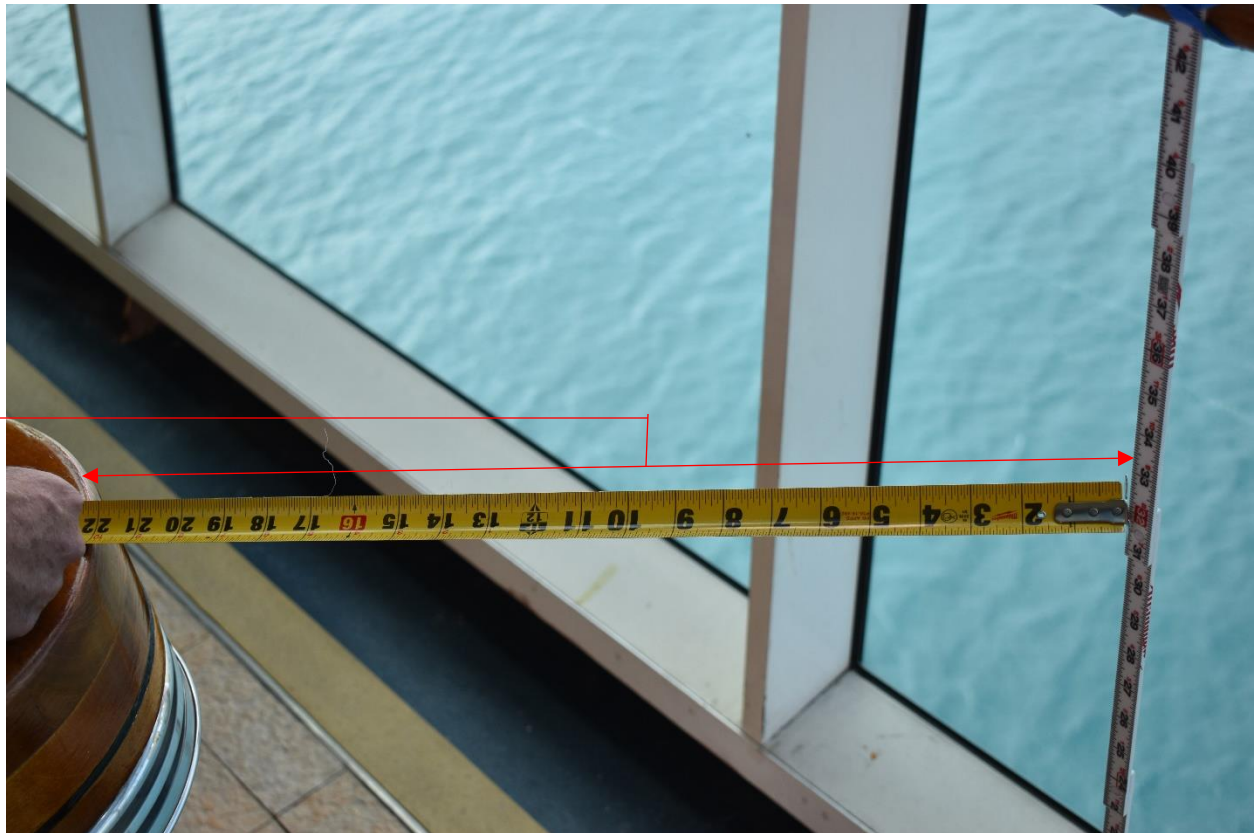



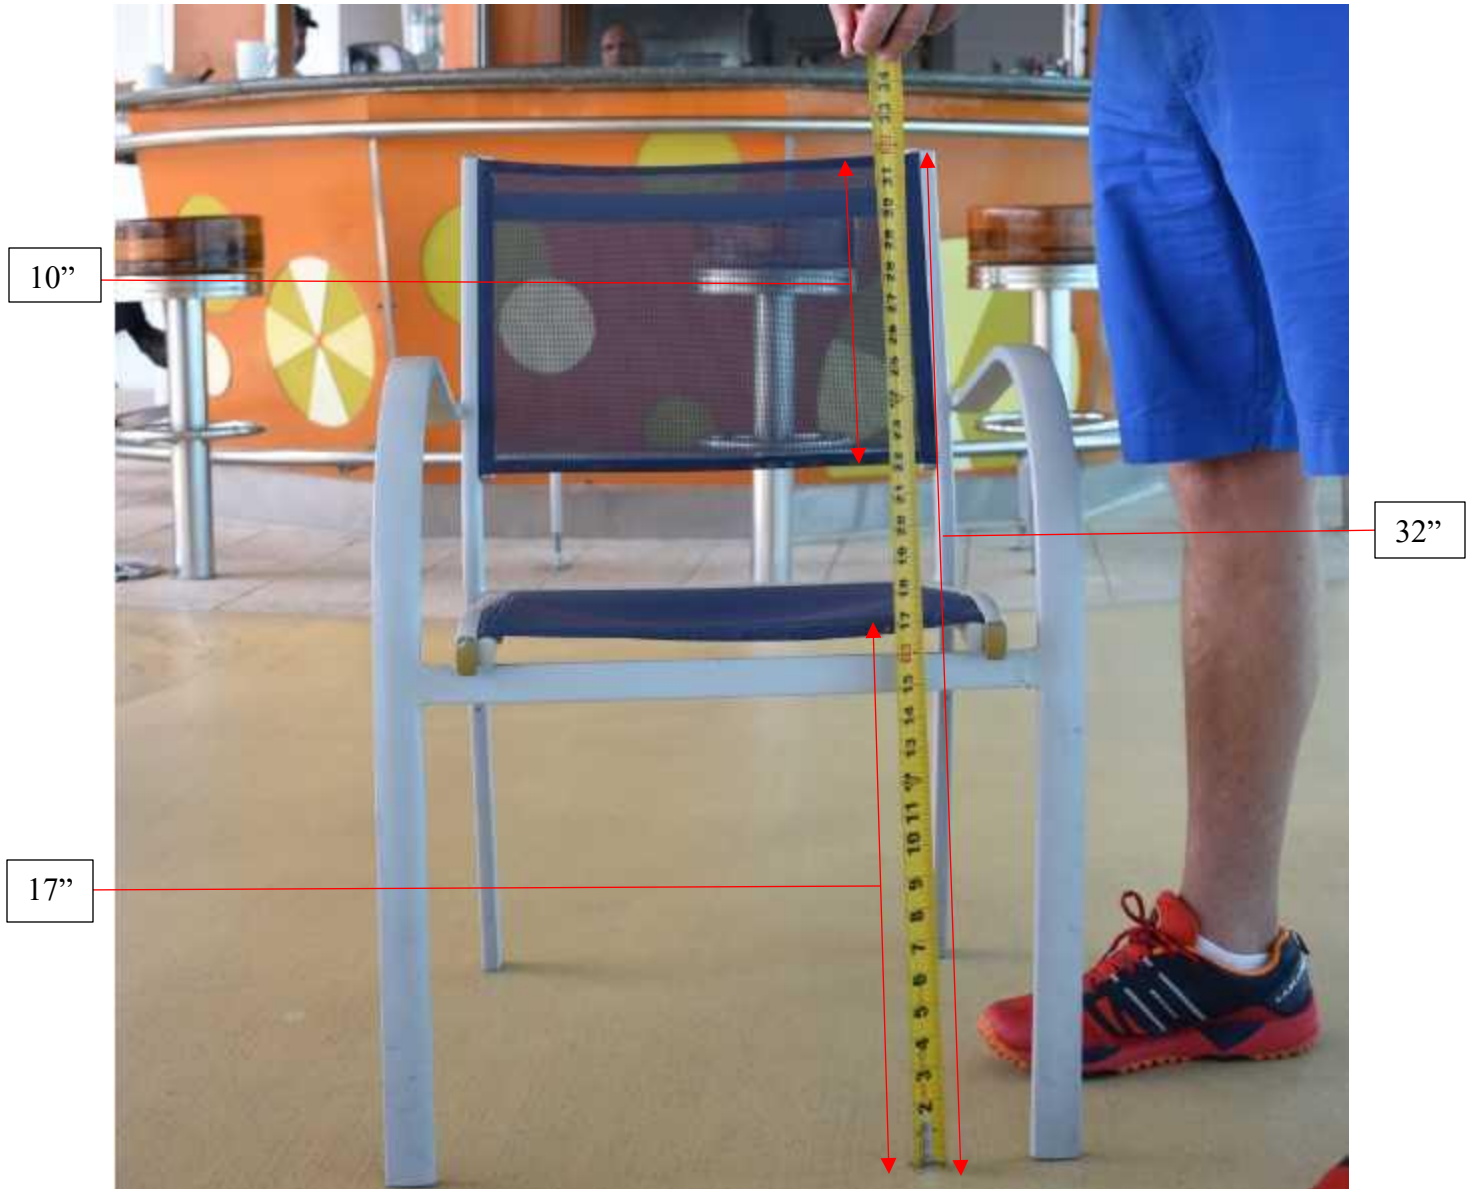



POUNDS OF FORCE TO OPEN SUBJECT WINDOW




FIXED GLASS DECK 12










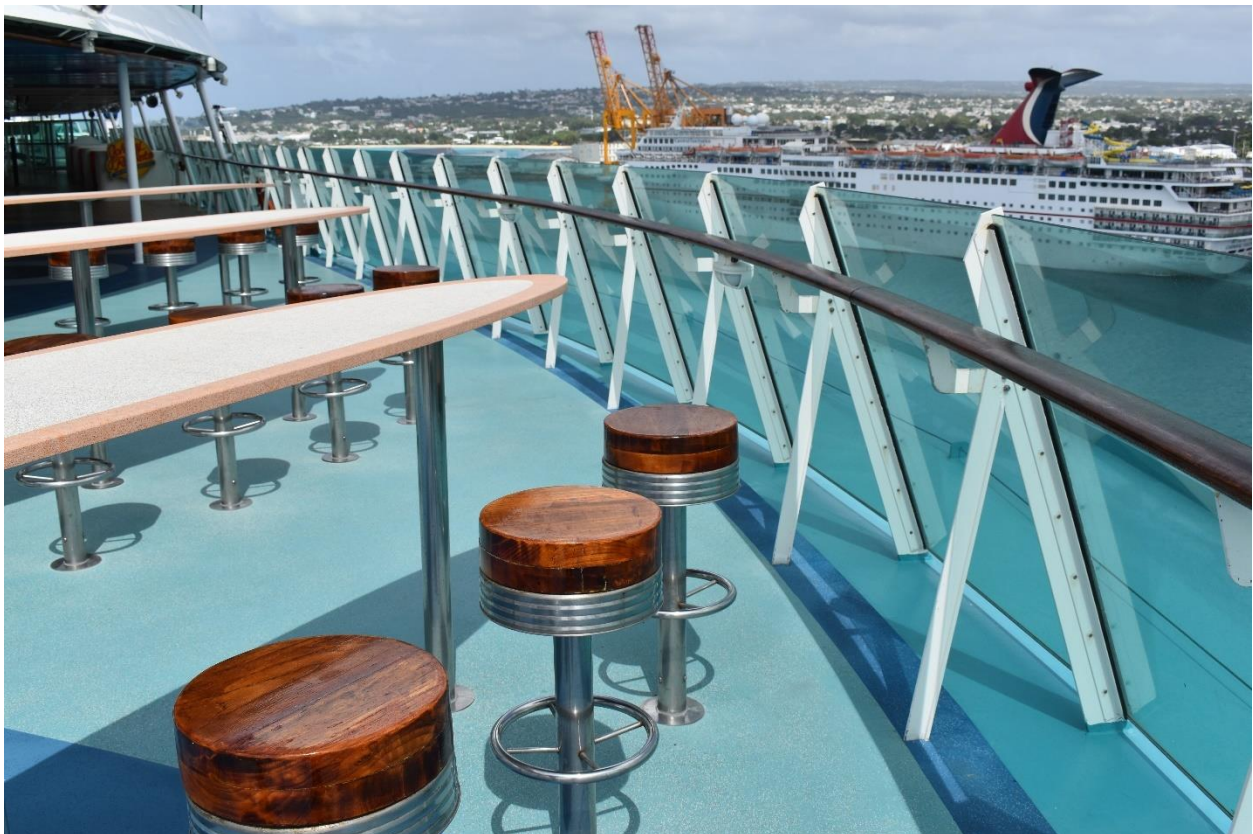







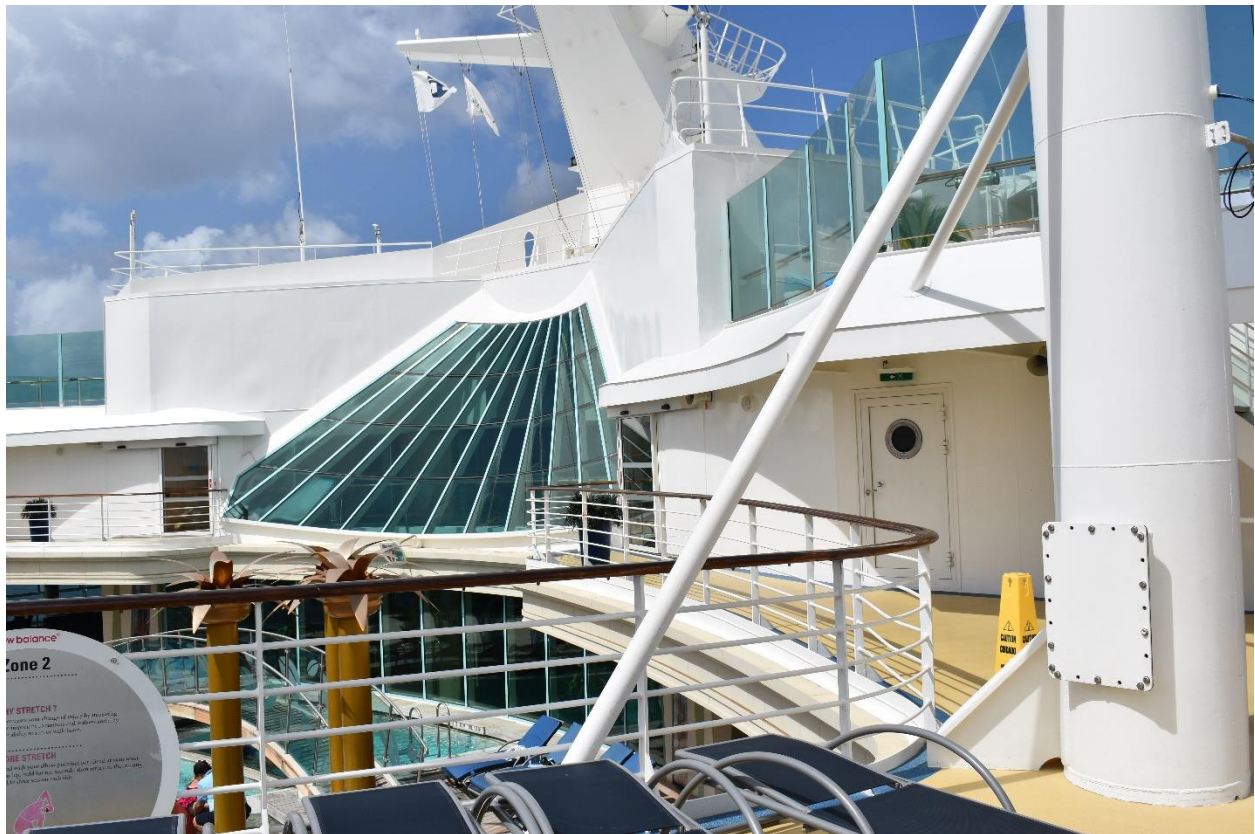



ON DECK WARNINGS



